
Resident witnesses:

location of this corner.

Miles	Н.,	Coc	hran	e
				•

Brian James

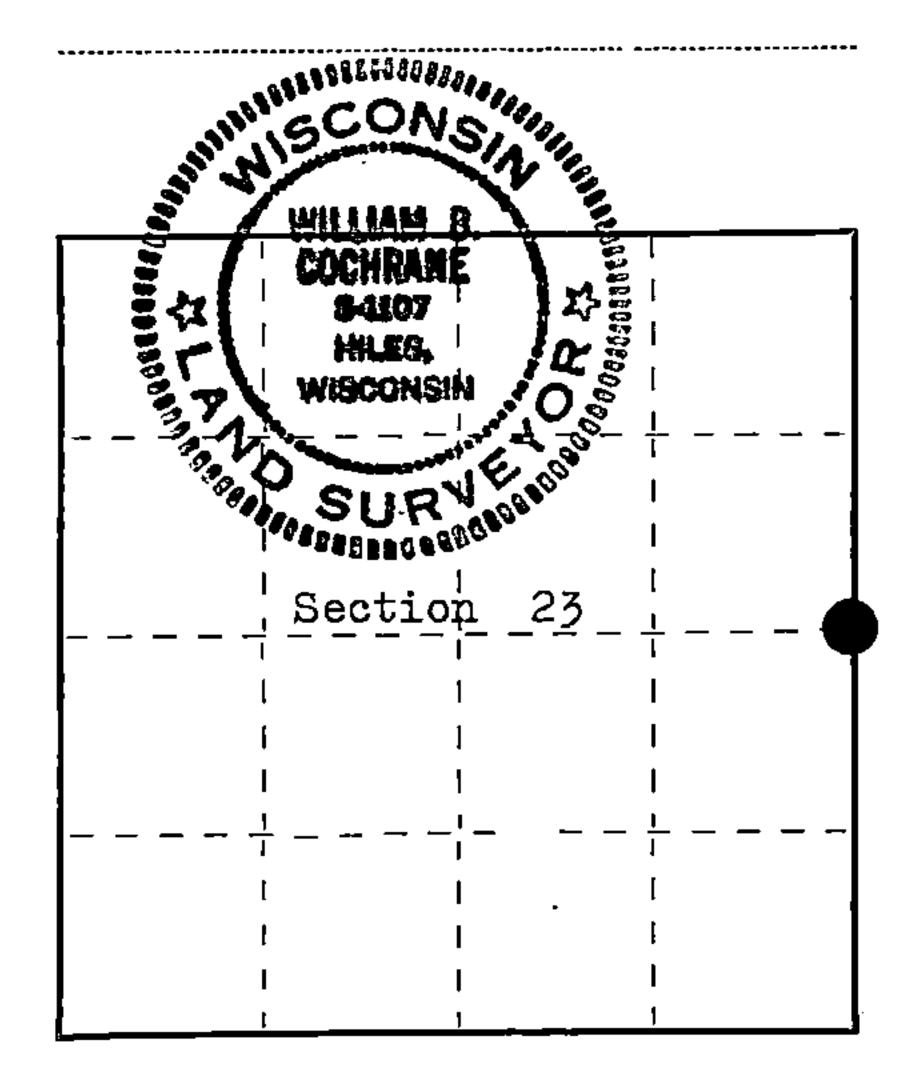

O = Corner monument restored.

History of original corner establishment:

Surveyed in 1859 by Wm. E. Daugherty North between Sections 23 and 24 40.00 chs. Set Quarter Section Post Hemlock, 6", N 40° E, 71 lks Hemlock, 6", S 10° W, 83 lks

CERTIFIED LAND CORNER RESTORATION

Description of corner evidence found:

No evidence of the corner was found. New road construction would have destroyed and corner evidence. Using the road center line for control in longitude, I set the corner at the midpoint between the Section Corners. This agrees with the original location of the road before construction.

Description of monument and accessories I established to perpetuate the original location of this corner.								
At the corner position, I set a 1" inside diameter, galvanized								
pipe, 30 inches long, 4 inches below the road surface. I set								
a 2½" Berntsen, A-1 Federal monument S 86° 08' 37" W, 100.00 feet,								
with cap stamped:								

T37N R12E, 14, S23, S24, 1977, S-1107, REFERENCE CORNER 100FT From the iron pipe: A Maple, 12", Bears S 53° E, 76.00 feet N 00° 53' 07" W, 2675.02 to the Northeast Section Corner of Section 23

S 00° 41' 24" E, 2675.02 to the Southeast Section Corner of Section 23

(Register of Deeds

Dated at Hiles	, Wis., this	23.rd	day ofA	ugust	
Signature William B. Coc	hrauc title	Land Sur	veyor	Registra	tion No.S-1107
(County Surveyor, Re	egistered Land Survey	or, or other duly	authorized omciai,	}	
Office of Register of Deeds, County instrument was filed in this office for	ofFO	REST		., I hereby cert	ify that the within
instrument was filed in this office for	or record on the	24th	day of	AUGUST,	<u>, 19.77</u>
at 10:20 o'clock A. My					
Jan 1			DOCUMENT	NUMBER	112188
mann fax	many				