PLAT OF SURVEY FOR CERTIFIED LAND CORNER


Page 1 of 4

RESTORATION AND ESTABLISHMENT

BEING THE CORNERS FOR THE NE 1/4 OF THE SE 1/4. AND THE CORNERS ON THE PERIMETER OF THE SECTION.

SECTION 9, TOWNSHIP 40 NORTH, RANGE 13 EAST.

COUNTY OF FOREST, STATE OF WISCONSIN.

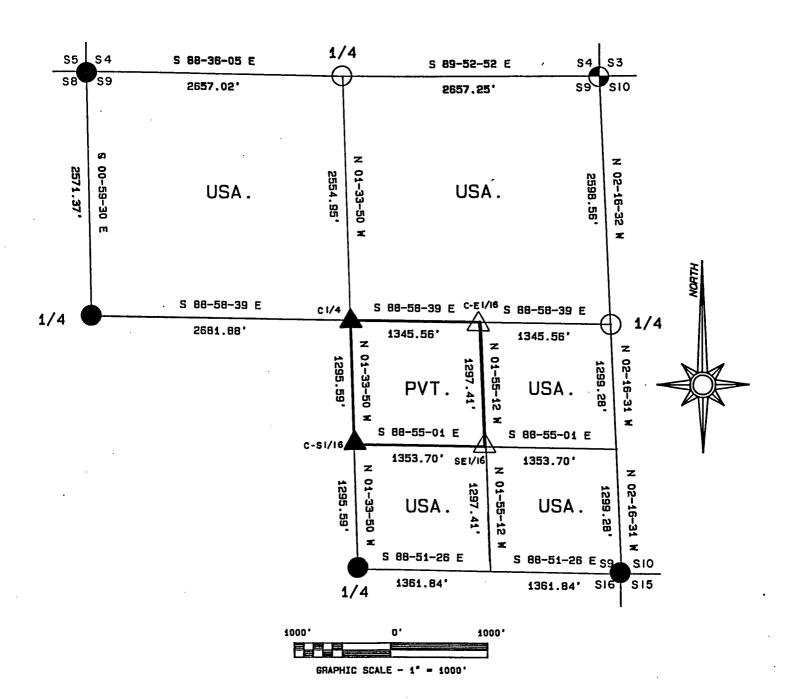

LEGEND

 $^{\prime}$ 2 1/2 INCH DIAMETER GALVANIZED IRON PIPE MONUMENT WITH BRASS CAP.

- 1 INCH DIAMETER ALUMINUM PIPE MONUMENT 36 INCHES LONG WITH AN ALUMINUM CAP.
- 1 INCH DIAMETER ALUMINUM PIPE MONUMENT 60 INCHES LONG WITH AN ALUMINUM CAP.
- 2 1/2 INCH DIAMETER ALUMINUM PIPE MONUMENT 36 INCHES LONG WITH AN ALUMINUM CAP.

RAIL ROAD SPIKE IN ROAD SURFACE REFERENCED BY PIPE MONUMENT.

BOUNDARY LINE MARKED TO FOREST SERVICE STANDARD

FOREST CO SURVEYOR FILE # 401309-19926928 DATE



Stock No. 26273

T40N R13E - SECTION 9

Page 2 of 4

SURVEY NOTES

This survey was made by the U.S. Department of Agriculture, Forest Service for the purpose of recovering, restoring, establishing, marking, and perpetuating the corners and boundary line of U.S. Government land on the perimeter and within Section 9, Township 40 North, Range 13 East, Fourth Principal Meridian, Forest County, State of Wisconsin as shown on the plat map herewith.

The Original Government Sub-division of this township was done in 1865 by William E. Daugherty.

The U.S. Government land within Section 9 was acquired in 1932, 1934, 1935, 1936 and 1939.

The bearings between corner positions are referenced to the East line of Section 25 as previously surveyed. No curvature corrections have been applied to the bearings in Section 9. The accuracy of this survey exceeds the State of Wisconsin requirement for closure of 1 part in 3000. Corners recovered or established by this survey are marked as described in the map legend. Each monumented corner is referenced to blazed, scribed, painted and tagged bearing trees. Tie bearings to the bearing trees are magnetic and are not corrected for declination.

The field notes and a copy of the plat of survey are on file in the Forest Service Supervisor's Office at Rhinelander, Wisconsin and the District Ranger's Office at Eagle River, Wisconsin.

CORNERS RECOVERED AND RESTORED

1. Northeast Section Corner

Corner position restored from old Highway 70 plan job number 7953.

Corner References:

r wereremees.							
White Pine	13"			N	33°	E	126.90 feet
White Pine	15"			S	47°	E	89.63 feet
Reference Corner	Monument			S	8 °	E	64.50 feet
White Pine	13"			N	46°	W	110.85 feet
Steel Sign Post	South	0 72	foot	οf	tho	Deference	Monument

2. East Quarter Corner

Corner position restored at midpoint and on line between the Northeast and Southeast section corners.

Corner References:

Spruce	8"	N 67° E	22.74 feet
Spruce	6"	N 2° W	16.28 feet
Steel Sign Post		Northwest	0.50 feet

3. Southeast Section Corner

Corner position restored in 1975 by a Bureau of Land Management Dependent Resurvey. 1975 Corner References Recovered:

	Spruce		6" (Dead	i)		N 21°	E	30.69	feet
	White Pine		14"			s 26°	E	16.17	feet
New	Corner Refere	ences:							
	Aspen		3"			N 58°	E	10.63	feet
	No bearing	trees	available	in	the	Southwe	st or	Northwest qua	drants.
	Steel Sign	Post				South	east	1.00	feet



Stock No. 26273

T40N R13E - SECTION 9

Page 3 of 4

4.	South	Quarter	Corner

Corner position restored in 1975 from a Bureau of Land Management Dependent Resurvey. 1975 Corner References Recovered:

White Birch 13" N 54° E 17.16 feet
Maple 16" S 15° W 17.16 feet
New Corner References:
Steel Sign Post South 0.50 feet

5. West Quarter Corner

Corner position restored in 1975 from a Bureau of Oand Management Dependent Resurvey. 1975 Corner References Recovered:

dormer meteremeen	. MCCCCTCLCG.		
Spruce (Dead)	8"	N 45° E	16.50 feet
New Corner References:			
Aspen	7"	S 67° E	21.76 feet
Aspen .	12"	S 18° E	28.30 feet
Steel Sign Post		East	0.50 feet

6. Northwest Section Corner

Corner position recovered and restored in 1959 by Robert Bandow, RLS. Corner documentation is recorded on a Certified Land Corner Restoration Certificate filed in the Forest County Registrar of Deeds Office as Document No. 83247. 1959 Corner References Recovered:

Red Pine	12"	N 7° E	61.50 feet
Spruce (Dead)	11"	S 85° E	16.50 feet
White Birch	13"	S 80° W	21.40 feet
New Corner References	::		
Red Pine	16"	N 37° E	38.35 feet
Spruce	8"	S 32° E	35.30 feet
Steel Sign Post		Southeast	0 50 feet

8. North Quarter Corner

Corner position recovered and restored in 1959 by Robert Bandow, RLS. Corner documentation is recorded on a Certified Land Corner Restoration Certificate filed in the Forest County Registrar of Deeds Office as Document No. 83252. The monument set in 1959 was removed for highway construction and was replaced with a 2 1/2" diameter x 36" long aluminum monument.

1959 Corner References Recovered:

Cedar	12"	S 25° E	68.50 feet
Cedar	14"	s 25° 30' W	47.20 feet
New Corner References:			
Steel Sign Post		South	19.00 feet

CORNERS ESTABLISHED

1. Center Quarter Corner

Corner position established at the intersection of straight lines between opposing quarter corners on the perimeter of the section.

Corner References:

Cedar	12"	S 84° E	8.67 feet
Cedar	9"	S 54° W	10.11 feet
Steel Sign P	ost	West	0.75 feet

, FORM NO. 985-A

H.C. Milter Company

Stock No. 26273

T40N R13E - SECTION 9

Page 4 of 4

Center East Sixteenth Corner

Corner position established at midpoint and on line between the Center quarter corner and the East quarter corner.

Corner References:

 Maple
 6"
 N 26° E
 12.47 feet

 Maple
 5"
 S 56° E
 17.79 feet

 Steel Sign Post
 Northeast
 1.75 feet

3. Center South Sixteenth Corner

Corner position established at midpoint and on line between the Center quarter corner and the South quarter corner.

Corner References:

Tamarack 9" N 50° E 6.37 feet Spruce 12" N 60° W 13.16 feet Steel Sign Post Southwest 0.05 feet

4. Southeast Sixteenth

Corner position established at the intersection of straight lines between opposing sixteenth corners on the perimeter of the Southeast quarter of section 9.

Corner References:

Maple	5"	N 47° E	27.73 feet
Maple	6"	N 20° W	10.62 feet
Steel Sign Post		Southeast	1.00 feet

SURVEYOR'S AFFIDAVIT

State of Wisconsin)

)ss

County of Forest)

I, William B. Cochrane, Land Surveyor, U.S.D.A. Forest Service and a Registered Land Surveyor in the State of Wisconsin, hereby certify that I have surveyed and sub-divided Section 9, Township 40 North Range 13 East, Fourth Principal Meridian, Forest County, State of Wisconsin.

The plat map and survey notes herewith are a correct representation of the land surveyed and sub-divided. I have surveyed and sub-divided said section in accordance with the rules for the Survey of Public Lands and the Statutes of the State of Wisconsin.

WILLIAM B. COCHRANE S-1107 HILES.

WISCONSIA

Land Surveyor, U.S.D.A. Forest Service

R.L.S. State of Wisconsin

Certificate S-1107

Date of Survey: 1991

Survey requested by:

District Ranger

9/28/92

Date

