
H C. Miller Company


Stock No. 26273

SHEET I OF 1

# PLAT OF SURVEY U.S. GOVERNMENT LAND

Being the North 1/2, SW1/4, and N1/2 SE1/4, A11 In Section 19
Township 34 North, Range 14 East, Fourth Principal Meridian
FOREST COUNTY, WISCONSIN



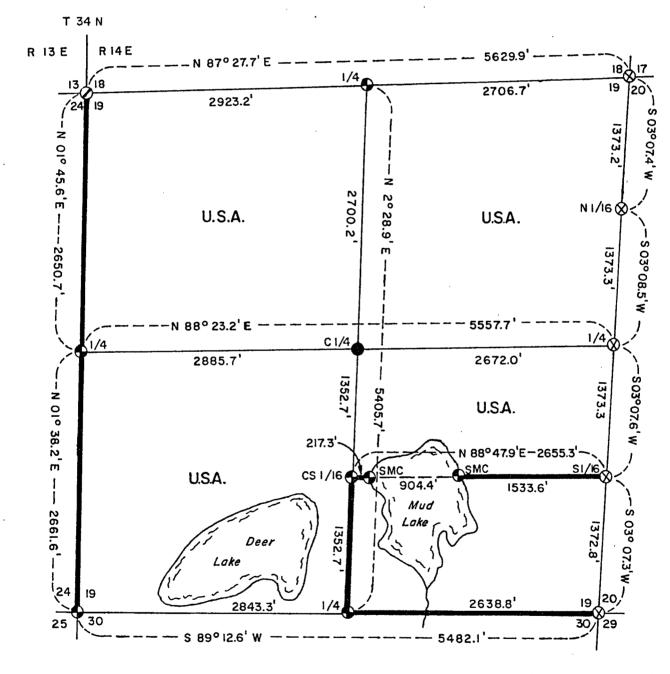

## LEGEND

- ⊗ 2" Iron Pipe with 3" Brass Cap Forest Service
- □ 2" Diameter Aluminum Monument, 36" Long
- 2" Diameter Aluminum Monument, 60" Long
- Marked Boundary Line of U.S. Government Land

<b>FOREST</b>	<b>CO SURVEYOR</b>
FILE # 34	1419-19841228
DATE	BY

#### Stock No. 26273

Sheet 2 of 4

#### SURVEY NOTES

This survey was made by the U. S. Department of Agriculture, Forest Service, for the purpose of restoring and establishing corners on the perimeter of Section 19, for establishing subdivisional corners within Section 19, and for locating and marking the boundaries of U. S. Government lands on their perimeter and within Section 19, Township 34 North, Range 14 East, Fourth Principal Meridian, Forest County, Wisconsin.

The U. S. Government lands in this section were acquired in 1935.

The original government survey of the range line was established by Alfred Millard in 1857. Township 34 North, Range 14 East was subdivided by James McBride in August of 1859.

Subsequent surveys were conducted by Neal Sperhake for Kimberly Clark Corporation in 1961 - 1964 along the range line. North Country Surveyors have failed to perform the proper subdivision of this section; therefore, it has been reworked by the Forest Service. Section 20, to the east, was surveyed by the Forest Service in 1977 - 1978.

The control traverse for this survey was done by North Country Surveyors, and a relative accuracy of 1 part in 18,400 was achieved.

The bearings between corner positions are true bearings based on solar observations.

The corner positions recovered, restored, and established by this survey are marked by the monument described in the map legend.

The field notes of this survey and a copy of this plat are on file in the Forest Supervisor's Office at Rhinelander, Wisconsin.

#### CORNERS RECOVERED AND RESTORED

1. Section Corner to Sections 19 and 30, T.34N., R.14E. and Sections 24 and 25, T.34N., R.13E.

Corner position was restored from the remains of the original bearing trees and a fallen post and post point.

Corner References:

Sugar Maple	6"	n.60°E.	9.41	feet
Sugar Maple	6"	s.60°E.	9.66	feet
Sugar Maple	6"	s.50°W.	22.27	feet
Sugar Maple	8"	N.80°W.	16.55	feet
Steel Sign Post		North	2.80	feet
K.C. Monument		N.81°24'33"E.	72.80	feet

2. Section Corner to Sections 18 and 19, T.34N., R.14E. and Sections 13 and 24, T.34N., R.13E.

Corner position was restored from original evidence by Neal Sperhake in 1961. Certificate on file.

Corner References:

Sugar	Maple	6" (*8")	N.53°W.	(*N.52°W.)	30.46	(*29.88)	feet
White	Elm	6" (*8")	s.44°W.	(*S.53°W.)	7.92	(* 7.73)	feet
White				(*N.30°E.)		(*22.35)	
Maple		5" (*5")	s.54°E.	(*S.51°E.)	7.92	(* 7.78)	feet
Above	are Sperhake	s references	of 1961	and (*Winat's	refere	nces of	1982).
					1.00		

## H.C. Miller Company

## Stock No. 26273

Sheet 3 of 4

0.50 feet

- 3. Section Corner to Sections 17, 18, 19, and 20, T.34N., R.14E. Corner position found marked by a Forest Service monument. Certificate on file.
- 4. Section Corner to Sections 19, 20, 29, and 30, T.34N., R.14E. Corner position found marked by a Forest Service monument. Certificate on file by Genisot Engineering, 1959, Document Number 82173.
- 5. Quarter Corner to Sections 19 and 24, T.34N., R.13E. and R.14E. Corner position restored from remains of the original bearing tree and post hole.

  Corner References:

Sugar Maple	8 <b>''</b>	N.87°E.	10.50	feet
Sugar Maple	6"	s.48°W.	23.16	feet
Sugar Maple	5 <b>''</b>	n.89°w.	13.56	feet
Steel Sign Post		South	1.20	feet
K.C. Monument		s.67°26'42"E.	37.11	feet

6. Quarter Corner to Sections 18 and 19, T.34N., R.14E.
Corner position restored by single proportionate measure from section corners east and west.
Corner References:

Basswood	12"	N.82°W.	6.47	feet
Basswood	6"	N.5°E.	6.21	feet
Basswood	6"	s.69°E.	6.40	feet
Steel Sign Post		Northwest	3.10	feet
Monument set by	North	Country Surveyors.		

7. Quarter Corner to Sections 19 and 20, T.34N., R.14E.

Corner position found marked by a Forest Service monument by Resvick in 1978.

Corner References:

\*Black Cherry 7" S.14°E. 41.59 feet
\*Black Cherry 7" S.66°W. 45.53 feet
Sugar Maple 5" N.52°W. 31.76 feet

West

Steel Sign Post \*By Resvick - 1978

8. Quarter Corner to Sections 19 and 30, T.34N., R.14E.

Corner position restored by single proportionate measure between the sections east and west.

Corner References:

12" N.83°E. 15.64 feet Basswood 9" S.24°E. 14.15 feet Basswood 5" N.84°W. 59.37 \*Sugar Maple feet Steel Sign Post North 1.90 feet

\*New bearing tree by North Country Surveyors.

## CORNERS ESTABLISHED

1. Center Quarter Corner to Section 19, T.34N., R.14E.

Corner established at the intersection of the one-quarter lines of Section 19.

Corner References:

Black Spruce	4"	N.62°E.	32.92	feet
White Birch	12"	S.31°E.	32.37	feet
Black Spruce	5"	N.7°W.	30.67	feet
Steel Sign Post	-	Northwest	1.90	feet

19

#### H.C. Miller Company

#### Stock No. 26273

Sheet 4 of 4

2. Center South Sixteenth Corner to Section 19, T.34N., R.14E.

Corner established midpoint and on line between the center quarter corner and south quarter corner to Section 19.

Corner References:

Sugar Maple	8"	N.18°E.	19.89	${ t feet}$
Sugar Maple	711	s.29°W.	14.15	feet
Sugar Maple	8"	N.72°W.	8.95	feet
Steel Sign Post		South	2.50	feet

3. Special Meander Corner, West Shore of Mud Lake, on the South Sixteenth Line, Section 19, T.34N., R.14E.

Corner established on the south sixteenth line, 217.38 feet east of the center south sixteenth corner to Section 19. Corner References:

Basswood	14"	s.42°W.	17.20	feet
Sugar Maple	5 <b>''</b>	N.59°W.	25.05	feet
Steel Sign Post		West	2.90	feet

4. Special Meander Corner, East Shore of Mud Lake, on the South Sixteenth Line, Section 19, T.34N., R.14E.

Corner established on the south sixteenth line, 1533.56 feet west of the

Corner established on the south sixteenth line, 1533.56 feet west of the south sixteenth to Sections 19 and 20. Corner References:

Spruce	4"	N.55°W.	2.02 fee	t
Red Pine	8"	N.61°E.	9.86 fee	t
Steel Sign Post		East	2.30 fee	t

## SURVEYOR'S AFFIDAVIT

State of Wisconsin County of Forest

55

I, Milo E. Stefan, Cadastral Surveyor, U. S. Forest Service, and a registered surveyor in the State of Wisconsin, hereby certify that I have surveyed and subdivided Section 19, Township 34 North, Range 14 East, Fourth Principal Meridian, State of Wisconsin.

The plat map and the notes herewith are a correct representation of the land surveyed and divided. I have surveyed and subdivided said section in accordance with the rules for survey of the public lands and with the statutes of the State of Wisconsin.

MILO ESTEFAN
S-1558
RHINELANDER,
WIS.

Date of Survey: 1982 - 1984

Cadastral Surveyor, J. S. Forest Service R.L.S., State of Wisconsin Certificate S-1558

Plat Ready For Filing: District Ranger

DEC 2 8 1984

FOREST CO. CLERK
Crandon, WI

Saelie L'Deer Deputy Co. Clerk