FORM NO. 985-A

Stock No. 26273

FOREST CO SURVEYOR
FILE # 401414-19810412
DATE ______BY ___


page 1 of 4

PLAT OF SURVEY FOR CERTIFIED LAND CORNER RESTORATION AND ESTABLISHMENT

BEING THE CORNERS FOR THE N 1/2 OF THE NW 1/4, THE SE 1/4 OF THE NE 1/4, AND THE S 1/2 OF THE SECTION

SECTION 14 TOWNSHIP 40 NORTH, RANGE 14 EAST.

COUNTY OF FOREST, STATE OF WISCONSIN

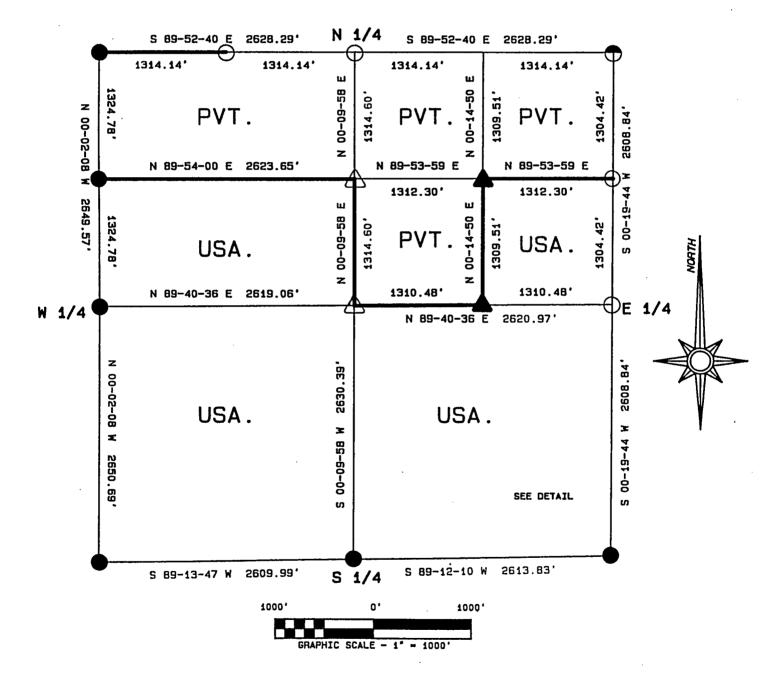

LEGEND

6 INCH CONCRETE MONUMENT 36 INCHES LONG WITH BRASS CAP EMBBED IN TOP.

1 INCH DIAMETER ALUMINUM PIPE MONUMENT 36 INCHES LONG WITH AN ALUMINUM CAP.

1 INCH DIAMETÈR ALUMINUM PIPE MONUMENT 80 INCHES LONG WITH AN ALUMINUM CAP.

2 1/2 INCH DIAMETER ALUMINUM PIPE MONUMENT 36 INCHES LONG WITH AN ALUMINUM CAP.

2 1/2 INCH DIAMETER ALUMINUM PIPE MONUMENT 60 INCHES LONG WITH AN ALUMINUM CAP.

BOUNDARY LINE MARKED TO FOREST SERVICE STANDARD.



Stock No. 26273

T40N R14E - SECTION 14

page 2 of 4

SURVEY NOTES

This survey was made by the U.S. Department of Agriculture, Forest Service, for the purpose of recovering, restoring, establishing, marking, and perpetuating the corners and boundary lines of U.S. Government Land on the perimeter and within Section 14, Township 40 North, Range 14 East, Fourth Principal Meridian, Forest County, State of Wisconsin, as shown on the Plat Map herewith.

The U.S. Government Land within Section 14 was acquired in 1935 and 1972.

The Original Government Subdivision of this township was made in 1865.

The bearings between corner positions are true bearings as determined by reference to solar observations. The accuracy of this survey exceeds the State requirement for closure of 1 in 3,000. Corners recovered or established by this survey are marked as described in the map legend. Each monumented corner is referenced to blazed, scribed, painted and tagged bearing trees. Tie bearings are magnetic, and not corrected for declination.

The field notes and a copy of the Plat of Survey are on file in the Forest Supervisor's Office at Rhinelander ψ Wisconsin.

CORNERS RECOVERED AND RESTORED

1. Northeast Section Corner

Corner position recovered as restored by William Cochrane in 1981 from remains of original bearing tree stumps and recovered 4"x4" wood post. Corner References:

Spruce	6"	SO5°E	54.11 feet
Spruce	6"	S47°W	36.40 feet
Spruce	5"	N30°W	58.46 feet
Steel Sign Pos	t	North	0.50 feet

2. East Quarter Corner

Corner position recovered as restored by William Cochrane in 1981 at proportionate distance and on line between section corners North and South. Corner References:

Spruce	9"	N60°W	11.67 feet
Spruce	11"	N11°E	13.85 feet
Steel Sign	Post	Northeast	0.50 feet

3. Southeast Section Corner

Corner position recovered as restored by Jean Resvick in 1967 from remains of the 1944 Dependent Resurvey. Corner References:

Spruce	6"	N28°W	45.61 feet
Birch	10"	N49°E	23.76 feet
Birch	11"	S47°W	32.34 feet
Spruce	911	S74°W	12.54 feet
Wood Sign Pos	t	Northwest	2.00 feet

4. South Quarter Corner

Corner position recovered as restored by William Cochrane in 1981, from recovered 1944 Dependent Resurvey Monument.

Corner References:

4"x4" Wood Post	North	33.00 feet
Witness Monument, 5" diamete	er concrete monument	3 feet long with brass cap.
References to Witness Monume		

E1m	15"	N50°E	73.26 feet
Maple	7"	S08°E	25.74 feet
Steel Sign	Post	South	0.50 feet

H C Miller Company

Stock No. 26273

T40N R14E - SECTION 14

page 3 of 4

5. Southwest Section Corner

Corner position recovered as restored by Jean Resvick in 1967 from a recovered 1944 Dependent Resurvey Monument.

Corner References:

Witness Monument 6"diameter concrete monument with brass cap.

References to Witness Monument:

Cherry 12" S25°E 55.44 feet Cherry 12" S05°W 75.90 feet 4"x4" Wood Post Southwest 1.50 feet

6. West Quarter Corner

Corner position recovered as restored by Jean Resvick in 1967 from a recovered 1944 Dependent Resurvey Monument.

Corner References:

Witness Monument 6" diameter concrete monument with brass cap.

References to Witness Monument:

Spruce	8"	N45°E	6.84 feet
Spruce	8"	S62°E	10.64 feet
4"x4" Wood P	ost	Northeast	1.50 feet

7. Northwest Section Corner

Corner position recovered as restored by Jean Resvick in 1969 from recovered 1944 Dependent Resurvey Monument.

Corner References:

Spruce	9"	N31°E	118.84 feet
Elm (Dead)	5"	S42°W	65.09 feet
Spruce	6"	S64°W	55.49 feet
Spruce	ЯII	W°PFN	48.35 feet

8. North Quarter Corner

Corner position is restored at mid-point and on line between the Northwest and Northeast Section Corners.

Corner References:

Spruce	5"	N52°E	12.80 feet
Spruce	5"	S22°E	21.80 feet
Steel Sign Post		West	1.00 feet

CORNERS ESTABLISHED

1. West Sixteenth Corner between Sections 11 and 14 Corner position established at mid-point and on line between the North Quarter Corner and the Northwest Section Corner.

Corner References:

Aspen	10"	N82°W	60.16 feet
W. Birch	5"	N22°W	53.82 feet
Steel Sign P	ost	North	1.00 feet

2. North Sixteenth between Sections 14 and 15 Corner position is established at mid-point and on line between the West Quarter Corner and the Northwest Section Corner. Corner position was set by Resvick in 1967.

Corner References:

Spruce	9"	S53°E	32.23 feet
W. Birch	13"	S89°W	31.74 feet
4"x4" Wood	Sign Post	East	25.50 feet

3. Center North Sixteenth Corner

Corner position is established at mid-point and on line between the North Quarter Corner and the Center Quarter Corner. Corner References:

Spruce	6"	s36°W	19.20 feet
Spruce	7"	N58°W	24.87 feet
Steel Sign Post		Southeast	0.20 feet



Stock No. 26273

T40N R14E - SECTION 14

page 4 of 4

4. Northeast Sixteenth Corner

Corner position is established at the intersection of straight lines between opposing sixteenth corner positions on the perimeter of the northeast quarter of the section.

Corner References:

,5" Spruce N18°E 22.02 feet 5" Spruce S64°W 22.42 feet 1.00 feet Steel Sign Post Northwest

5. North Sixteenth Corner between Sections 13 and 14 Corner position is established at mid-point and on line between the Northeast Section Corner and the East Quarter Corner.

Corner References:

611 Maple S42°W 29.15 feet Maple 6" N70°W 28.98 feet Steel Sign Post Northeast 1.00 feet

6. Center Quarter Corner Corner position is established at the intersection of straight lines between opposing Quarter Corner positions on the perimeter of the Section. Corner References:

> 711 N86°E 28.80 feet Maple 6" S17°E 18.58 feet Maple Steel Sign Post Southeast 1.00 feet

7. Center East Sixteenth Corner Corner position is established at mid-point and on line between the Center Quarter Corner and the East Quarter Corner. 三〇三川

Corner References:

There are no references available.

SURVEYOR'S AFFIDAVIT

State of Wisconsin) County of Forest) ss

I William B. Cochrane, Land Surveyor, U. S. Forest Service, and a Registered Land Surveyor in the State of Wisconsin, hereby certify that I have surveyed and subdivided Section 14, Township 40 North, Range 14 East, Fourth Principal Meridian, State of Wisconsin.

The plat map and survey notes herewith are a correct representation of the land surveyed and divided. I have surveyed and subdivided said section in accordance with the rules for the survey of the public lands and with the statutes of the State of Wisconsin.

CONSIA WILLIAM B. **C**OCHRANE S-1107 WISCONSIN

Date of survey: 1987

Survey requested by;

APR | **2** |989

FOREST CO. CLERK Crandon, WJ

Land Surveyor, U.S. Forest Service R. L. S. State of Wisconsin

Certificate S-1107

3-22-89

District Ranger

Date