

Stock No. 26273


FOREST CO SURVEYOR
 FILE # 40421-19880318
 DATE _____ BY _____

Sheet 1 of 4


PLAT OF SURVEY FOR CERTIFIED LAND CORNER
 RESTORATION AND ESTABLISHMENT

BEING THE CORNERS FOR THE NE1/4 AND NW1/4 OF SECTION 21,
 T.40N. R.14E., FOURTH PRINCIPAL MERIDIAN

COUNTY OF FOREST, STATE OF WISCONSIN

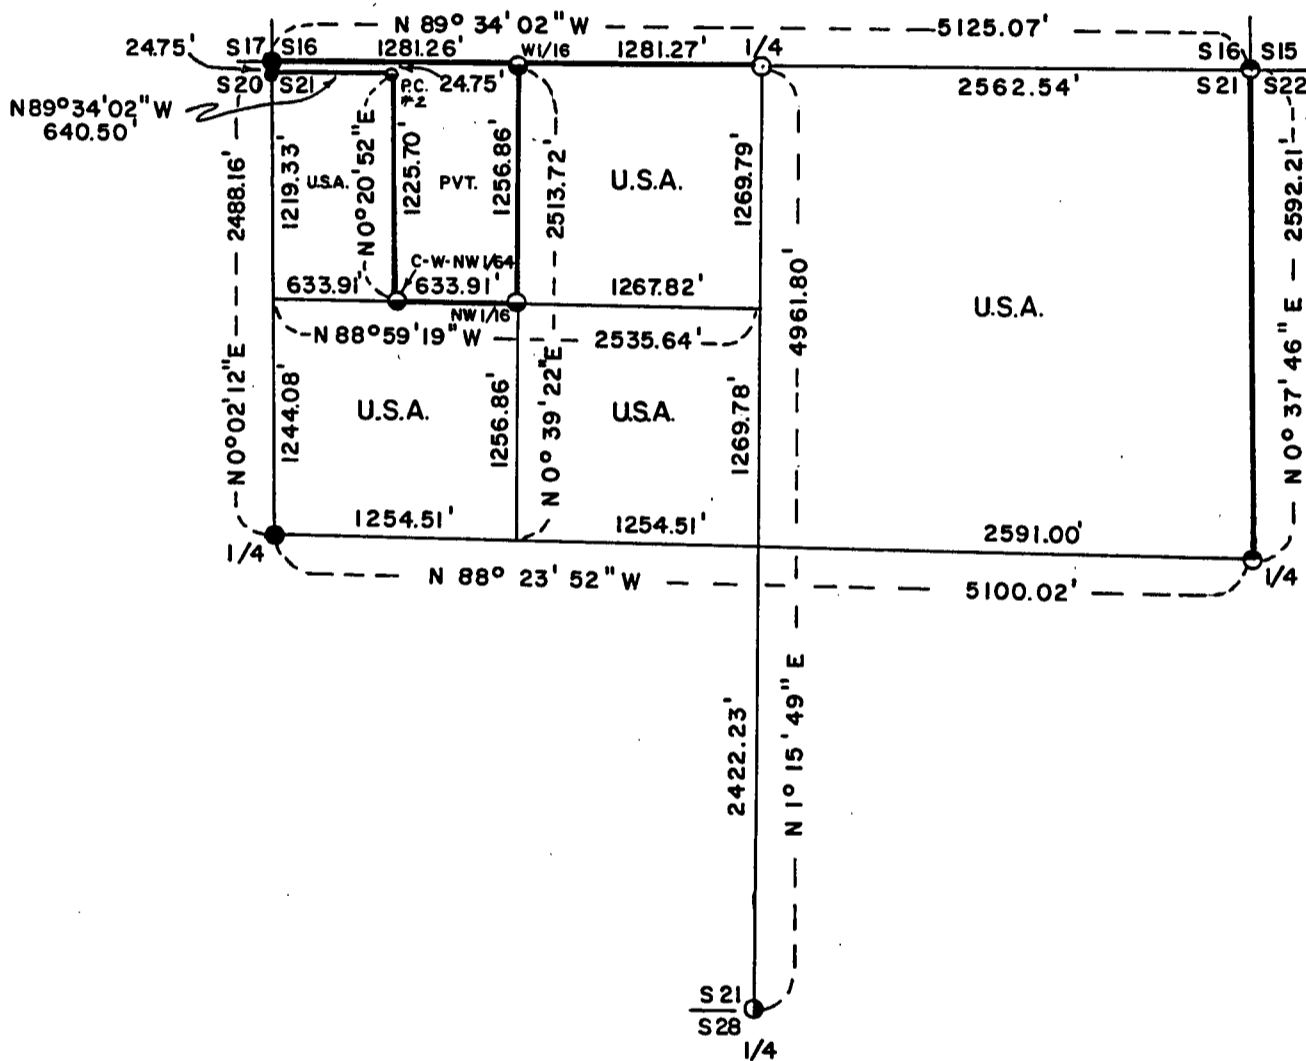

Scale 1" = 1000'



Scale in feet.

LEGEND

- -2 inch I.D. iron pipe monument, 36 inches long with a brass cap stamped to identify the corner found in place, set by Resvick.
- -2 inch I.D. iron pipe monument, 60 inches long with a brass cap stamped to identify the corner found in place, set by Resvick.
- ⊙ -2½ inch diameter iron pipe monument, 30 inches long with a brass cap stamped to identify the corner found in place, set by dependent resurvey of 1950.
- -2½ inch diameter aluminum pipe monument, 36 inches long with an aluminum cap stamped to identify the corner.
- -1 inch diameter aluminum pipe monument, 36 inches long with an aluminum cap stamped to identify the corner.
- -Boundary line marked to Forest Service standards.

Stock No. 26273

Sheet 2 of 4

SURVEY NOTES

This survey was made by Gary L. Pisoni, a Registered Land Surveyor in the State of Wisconsin, for the U.S. Department of Agriculture, Forest Service, for the purpose of recovering, restoring, establishing, marking and perpetuating the corners and boundary lines of U.S. Government land on the perimeter and within Section 21, Township 40 North, Range 14 East, Fourth Principal Meridian, Forest County, State of Wisconsin, as shown on the plat map herewith.

The original Government Subdivision of this township was made by Wm. Daugherty in 1865.

The bearings between corner positions are true bearings as determined by reference to a solar observation. The corners recovered by Jean Resvick, Cadastral Surveyor for the U.S. Forest Service and corners recovered by dependent resurvey of the U.S. Department of the Interior General Land Office in 1950 marking the perimeter of Section 21 were used as control for the subdivision survey of Section 21.

The accuracy of this survey exceeds the State requirements of 1 in 3000.

The field notes and a copy of the Plat of Survey are on file in the Forest Supervisor's office at Rhinelander, Wisconsin.

CORNERS RECOVERED AND RESTORED1. Section Corner Common to Sections 15, 16, 21, and 22.

Corner position marked by a monument from the 1950 Dependent Resurvey.

Corner references:

Black Spruce	4"	N.67°W.	19.10 feet
Poplar	14"	N.55°30'W.	17.80 feet
White Spruce	6"	N.71°E.	13.42 feet
White Birch	8"	S.65°E.	17.20 feet
Cedar	13"	S.43°30'W.	73.30 feet

New Corner reference:

Steel sign post		North	1.3 feet
-----------------	--	-------	----------

2. Quarter Corner Between Sections 16 and 21.

Corner position restored at midpoint and on line between the Northeast and Northwest Section corners of Section 21.

Corner references:

Black Spruce	9"	S.51°W.	13.76 feet
Cedar	8"	N.80°W.	14.49 feet
Cedar	7"	N.03°30'W.	10.26 feet
Steel sign post		S.50°E.	0.73 feet

3. Section Corner Common to Sections 16, 17, 20 and 21.

Corner position recovered as restored by Jean Resvick in 1970.

1970 Corner references:

Maple	15"	S.41°54'W.	42.77 feet
Balsam	8"	N.32°16'W.	16.05 feet
NW cor of cabin		S.81°17'E.	52.55 feet
Steel sign post		N.27°W.	1.5 feet

New corner references:

Balsam	8"	S.34°E.	9.46 feet
--------	----	---------	-----------

Stock No. 26273

Sheet 3 of 4

4. Quarter Corner Between Sections 20 and 21.

Corner position recovered as restored by Jean Resvick in 1970.

1970 Corner references:

White Pine	16"	East	25.29 feet
Spruce	14"	N.01°E	20.62 feet

New corner reference:

Steel sign post		N.65°W.	2.25 feet
1970: Steel sign post		N.62°E.	1.5 feet

5. Quarter Corner Between Sections 21 and 28.

Corner position recovered as restored by Jean Resvick in 1974.

1974 Corner references:

Maple	20"	N.15°E.	115.94 feet
Steel sign post		South	0.50 feet

New corner reference:

Balsam	8"	S.61°E.	43.26 feet
--------	----	---------	------------

6. Quarter Corner Between Sections 21 and 22.

Corner position marked by a monument from the 1950 Dependent Resurvey.

Corner references:

Cedar	16"	S.48°E.	27.0 feet
Cedar	9"	S.08°30'W.	15.9 feet
Maple	9"	S.27°W.	14.69 feet
Maple	16"	N.20°W.	35.57 feet
Steel sign post		Southwest	1.0 feet

CORNER ESTABLISHED1. Property Corner No. 1 Between Sections 20 and 21.

Corner position recovered as established by Jean Resvick in 1970.

Corner references:

NW cor. of cabin		N.73°E.	54.57 feet
Section Corner		N.0°02'12"E.	24.75 feet
Steel sign post		S.57°W.	0.70 feet

New corner reference:

Balsam	8"	S.76°W.	13.72 feet
--------	----	---------	------------

2. Property Corner No. 2 of Section 21.

Corner references:

Sugar Maple	6"	N.52°E.	17.50 feet
Sugar Maple	8"	S.15°30'W.	30.53 feet
Steel sign post		North	0.80 feet

3. Center-West Northwest One-Sixty Fourth Corner of Section 21.

Corner position established at midpoint and on line between the Northwest One-Sixteenth corner and the North One-Sixteenth corner between sections 20 and 21.

Corner references:

Balsam	4"	N.42°E.	10.11 feet
Balsam	6"	S.23°30'W.	16.99 feet
Steel sign post		West	0.65 feet

Stock No. 26273

Sheet 4 of 4

4. Northwest Sixteenth Corner of Section 21.

Corner position established at the intersection of the straight lines between opposing sixteenth corners positions on the perimeter of the Northwest quarter of Section 21.

Corner references:

Black Cherry	12"	South	104.20 feet
Black Cherry	7"	S.89°W.	66.10 feet
Steel sign post		N.50°E.	0.85 feet

5. West Sixteenth Corner Between Sections 16 and 21.

Corner position established at midpoint and on line between the Northwest section corner and the North quarter corner of Section 21.

Corner references:


Red Maple	8"	S.32°30'W.	16.83 feet
Balsam	8"	N.46°W.	21.78 feet
Steel sign post		East	0.60 feet

SURVEYOR'S CERTIFICATE

State of Wisconsin)
County of Forest)^{ss}

I, Gary L. Pisoni, a Cadastral Surveyor, and a registered land surveyor in the State of Wisconsin, hereby certify that I have surveyed and subdivided Section 21, Township 40 North, Range 14 East, Fourth Principal Meridian, State of Wisconsin.

The plat map and survey notes herewith are a correct representation of the land surveyed and divided. I have surveyed and subdivided said section in accordance with the rules for the survey of public lands and with the statutes of the State of Wisconsin.

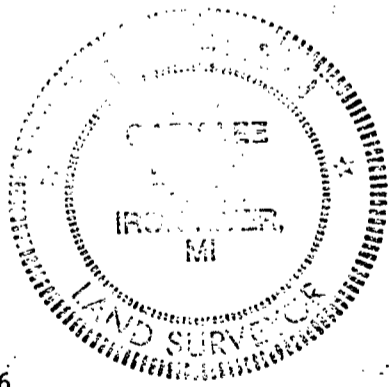

Date of Survey: 1986

Gary L. Pisoni
Cadastral Surveyor
R.L.S. State of Wisconsin
Certificate S-1634

Survey requested by:

Edward Wenger
District Ranger

3-7-88
Date

