FORM NO. 985-A

Stock No. 26273


FOREST CO SURVEYOR
FILE # 38/4/2 - 1980224
DATE \_\_\_\_\_\_\_BY

T 38 N - R 14 E, SECTION 12

# PLAT OF SURVEY FOR CERTIFIED LAND CORNER Sheet 1 of 4 RESTORATION AND ESTABLISHMENT

BEING THE CORNERS FOR THE N ½ OF THE SE ¼ AND THE SE ¼ OF THE SE ¼ SECTION 12, TOWNSHIP 38 NORTH, RANGE 14 EAST

FOURTH PRINCIPAL MERIDIAN, FOREST COUNTY, STATE OF WISCONSIN

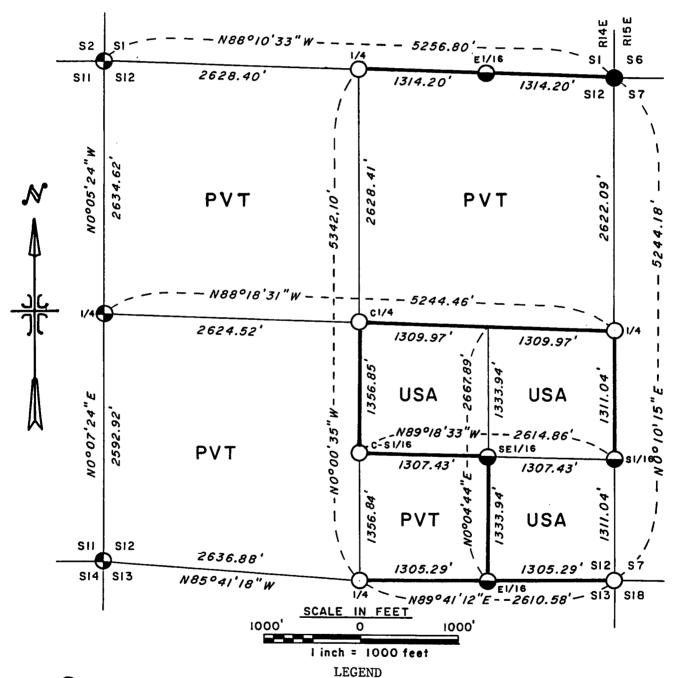

- O -- 2½ inch diameter aluminum pipe monument, 36 inches long with an aluminum cap stamped to identify the corner.
- ← 2½ inch diameter aluminum pipe monument, 36 inches long with an aluminum cap stamped to identify the corner buried in the road.
- -- 2½ inch diameter galvanized iron pipe monument, 60 inches long with a brass cap stamped to identify the corner.
- Boundary line marked to Forest Service standards.

H C. Miller Company

. .

### Stock No. 26273

# T 38 N - R 14 E, SECTION 12

### SURVEY NOTES

This plat of survey is the product of a Photogrammetric Project commencing in the fall of 1981, and completed in the spring of 1985 for Township 38 North Range 15 East, and Sections 1, 12, 13, 24, and 25, Township 38 North Range 14 East, Fourth Principal Meridian, State of Wisconsin.

All bearings are grid bearings referenced to a true North Central Meridian in the center of Township 38 North Range 15 East.

Co-ordinate values for corner positions were computed from photogrammetric target values with an adjusted R.M.S. factor of 1.21.

This survey was made by the U.S. Department of Agriculture, Forest Service for the purpose of recovering, restoring, establishing, marking, and perpetuating the corners and boundary lines of U.S. Government Land on the perimeter and within the sections in this project area.

The Original Government Survey of the township lines was made in 1857 by Artemas Curtis. The original subdivision of Township 38 North Range 15 East was made in 1865 by William E. Daugherty, and the original subdivision of Township 38 North Range 14 East was made in 1865 by H. and J.L. Nowlin.

The field notes of this survey and a copy of this and the remaining sections in this project area are on file in the Forest Service Supervisors Office at Rhinelander, Wisconsin.

### CORNERS RECOVERED AND RESTORED

# 1. Norhteast Section Corner.

Corner position recovered as restored by Jean Resvick from original evidence in 1964.

TOT COLUCE TOTOLOGO	Corner refere:	nces	:
---------------------	----------------	------	---

Aspen	5 "	N12°E	58.28	feet
Aspen	4 "	S35 OE N43 W	33.15	feet
Aspen	5 "	N43 W	41.59	feet

1965 Corner references recovered:

8" · 10" N12<sub>o</sub>E 58.28 feet Aspen N43 Aspen W 41.59 feet

Aspen S35 E cut down for Air Photo project.

New corner references:

s16°w 10" 69.95 feet Spruce

# 2. East Quarter Corner.

Corner position restored at midpoint and on line between the Northeast and Southeast Section corners.

Corner references:

Maple		12	**	S43 W N38 W	52.26	feet
Maple		7	"	м38Си	50.20	feet
Steel	sign	post		East	0.50	feet

## 3. Southeast Section Corner.

Corner position restored by single proportion measurements. Corner references:

Aspen	13"	N72°E S14°E N77°W	22.23	feet
Spruce	13"	S14°E	57.95	feet
Birch	8"	N77 <sup>°</sup> W	23.00	feet
Steel sign p	ost	Southwest	0.50	feet

### Stock No. 26273

# T 38 N - R 14 E, SECTION 12

Sheet 3 of 4

### 4. South Quarter Corner.

Corner position restored from ties to 874 dated 1934.

Corner references:

S42°E 4 " Maple 0.99 feet 579°W 6" Maple 15.84 feet 1.00 feet Steel sign post West

5. Southwest Section Corner.
Corner position restored at intersection of Old Hwy. 139 and Forest road 2397.

Corner references:

6" N51°E B. Ash 60.47 feet 11" s 7°E Spruce 124.41 feet s54°W Power Pole No.78-2468 32.69 feet

### 6. West Quarter Corner.

Corner position restored in center line of Old Hwy. 139 and East of old fence line.

Corner references:

N30°E S75°W Basswood E.fork 8" 62.59 feet Dbl. Basswood 12" 51.20 feet

### 7. Northwest Section Corner.

Corner position restored using center line of bridge on Old Hwy. 139 and original creek calls East and South and original swamp call West. Corner references:

NE Bridge Corner	S89°E	13.02 feet
NW Bridge Corner	589 W	13.01 feet
Power Pole No.78-1305	ท61 ัพ	34.57 feet

### 8. North Quarter Corner.

Corner position restored at midpoint and on line between the Northwest and Northeast Section Corners.

Corner references:

R.	Pine	6"	N63°E	4.02	feet
R.	Pine	6 <b>"</b>	N45 <sup>o</sup> w	6.03	feet
Ste	eel sign post		Southeast	0.50	feet

# CORNERS ESTABLISHED

# 1. East Sixteenth Corner between Sections 1 and 12. Corner position is established at midpoint and on line between the North Quarter Corner and the Northeast Section Corner. Corner references:

N85°W N20°W 5 " 14.72 feet 12.75 feet Spruce 8" W. Birch Steel sign post Southeast 1.00 feet

# 2. Center Quarter Corner.

Corner position is established at the intersection of the straight lines between opposing Quarter Corners on the permiter of the section.

Corner references:

Spruce	8"	S60°E	8.75 feet
Spruce	7 "	n15 <sup>0</sup> w	8.09 feet
Steel sign pos	st	Southeast	2.00 feet

3. <u>Center-South Sixteenth Corner.</u>
Corner position is established at midpoint and on line between the Center Quarter Corner and the South Quarter. Corner references:

Spruce	12"	N30 E	38.75	feet
Spruce	8"	S85 <sup>0</sup> E	38.45	feet
Steel sign	post	Northeast	2.50	feet

FORM NO. 985-A

Stock No. 26273

# T 38 N - R 14 E, SECTION 12

Sheet 4 of 4

4. Southeast Sixteenth Corner.

Corner position is established at the intersection of the straight lines between opposing Sixteenth Corners on the permiter of the Southeast Quarter of the section.

Corner references:

Cedar 7"  $560^{\circ}E$  19.90 feet Cedar 11"  $545^{\circ}W$  7.91 feet Steel sign post Northeast 1.00 feet

5. South Sixteenth Corner between Sections 7 and 12. Corner position is established at midpoint and on line between the East Quarter and the Southeast Section Corner. Corner references:

 Cedar
 8"
 N32°E
 9.40 feet

 Cedar
 8"
 S55°W
 25.67 feet

6. East Sixteenth Corner between Sections 12 and 13.
Corner position is established at midpoint and on line between the South Quarter and the Southeast Section Corner.
Corner references:


Tamarack 8" N50°W 19.60 feet Spruce 8" S65°W 13.50 feet Steel sign post Northeast 1.00 feet

# SURVEYOR'S AFFIDAVIT

State of Wisconsin) ss. County of Forest )

I William B. Cochrane, Land Surveyor, U.S. Forest Service, and a registered land surveyor in the State of Wisconsin, hereby certify that I have surveyed and subdivided Section 12 Township 38 North, Range 14 East, Fourth Principal Meridian, State of Wisconsin.

The plat map and survey notes herewith are a correct representation of the land surveyed and divided. I have surveyed and subdivided said section in accordance with the rules for the survey of the public lands and with the statutes of the state of Wisconsin.

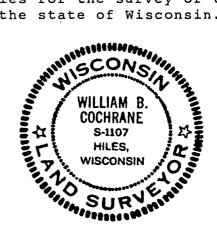

Land Surveyor, U.S. Forest Service

R.L.S. State of Wisconsin Certificate S-1107

Date of Survey: 1985

Plat ready for filing:

District Ranger

FEB 2 4 1987

FOREST CO. CLERK Scrandon, WI est Co. Clerk

Forest Co. Clark