<u> </u>	26273	\$ \$\ \$
HC.MillerCompa	Š	
Ţ,	Stock	7

U.S.	PUBLIC LAND SURVEY MONUMENT RECORD	Index No. N-23
State of Wisconsin County of Forest Gary L. Pisoni do hereby	History of original corner establishment: Original Government Survey in 1865 by William E. Daugherty and West corrected between Sections 13 and 24, at 40.06 chains, set Post to Sections 13 and 24, from which the following bear;	Alex McDill. t Quarter Section
certify that on the 15th day of August 19 90, I found evidence of the South Quarter corner of Section 13 Township 39, North, Range	Cedar 8" N14°E 28 lks. Cedar 12" S10°W 38 lks.	
13 East Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original	Description of corner evidence found: No original corner evidence was recovered.	
location of this corner. Resident witnesses:	I re-established the corner position at proportionate distance Southwest and Southeast Section Corners of Section 13.	and on line between the
# # # # # # # # # # # # # # # # # # #		. ; ; ;
	Description of monument and accessories I established to perpetuate the origina At the corner position, set a $2\frac{1}{2}$ inch diameter aluminum pipe measurements above the ground surface, with an aluminum cap stamper \$13, \$24, 1990, \$-1634. From which the following new blazed and bear; (all measurements taken to a nail in side of tree) W. Spruce 13" W. Spruce 13" W. Spruce 11" N74°W M. Spruce 10" N27°W N27°W M. Spruce 12" N79°E V7.47 feet Steel Sign Post S35°E O.66 feet	onument, 3 feet long, d; T39N, R13E, 1/4,
SECTION 13	Dated at Iron River, MI , Wisk this 8th day of Signature	I hereby certify that the within
= Corner monument restored.	(Register of Deeds) By Deputy	

Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

See drawing below.

(r) was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

Restored through lost corner proportionate methods.


(gkh) was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

Re-established through lost corner proportionate methods.

G.L.O. 40.06 chs.

S.14 S.13 2946.39' 2946.39' S.13 S.18

S.23 S.24 N88 12' 48 "E 5892.78' S.24 S.19

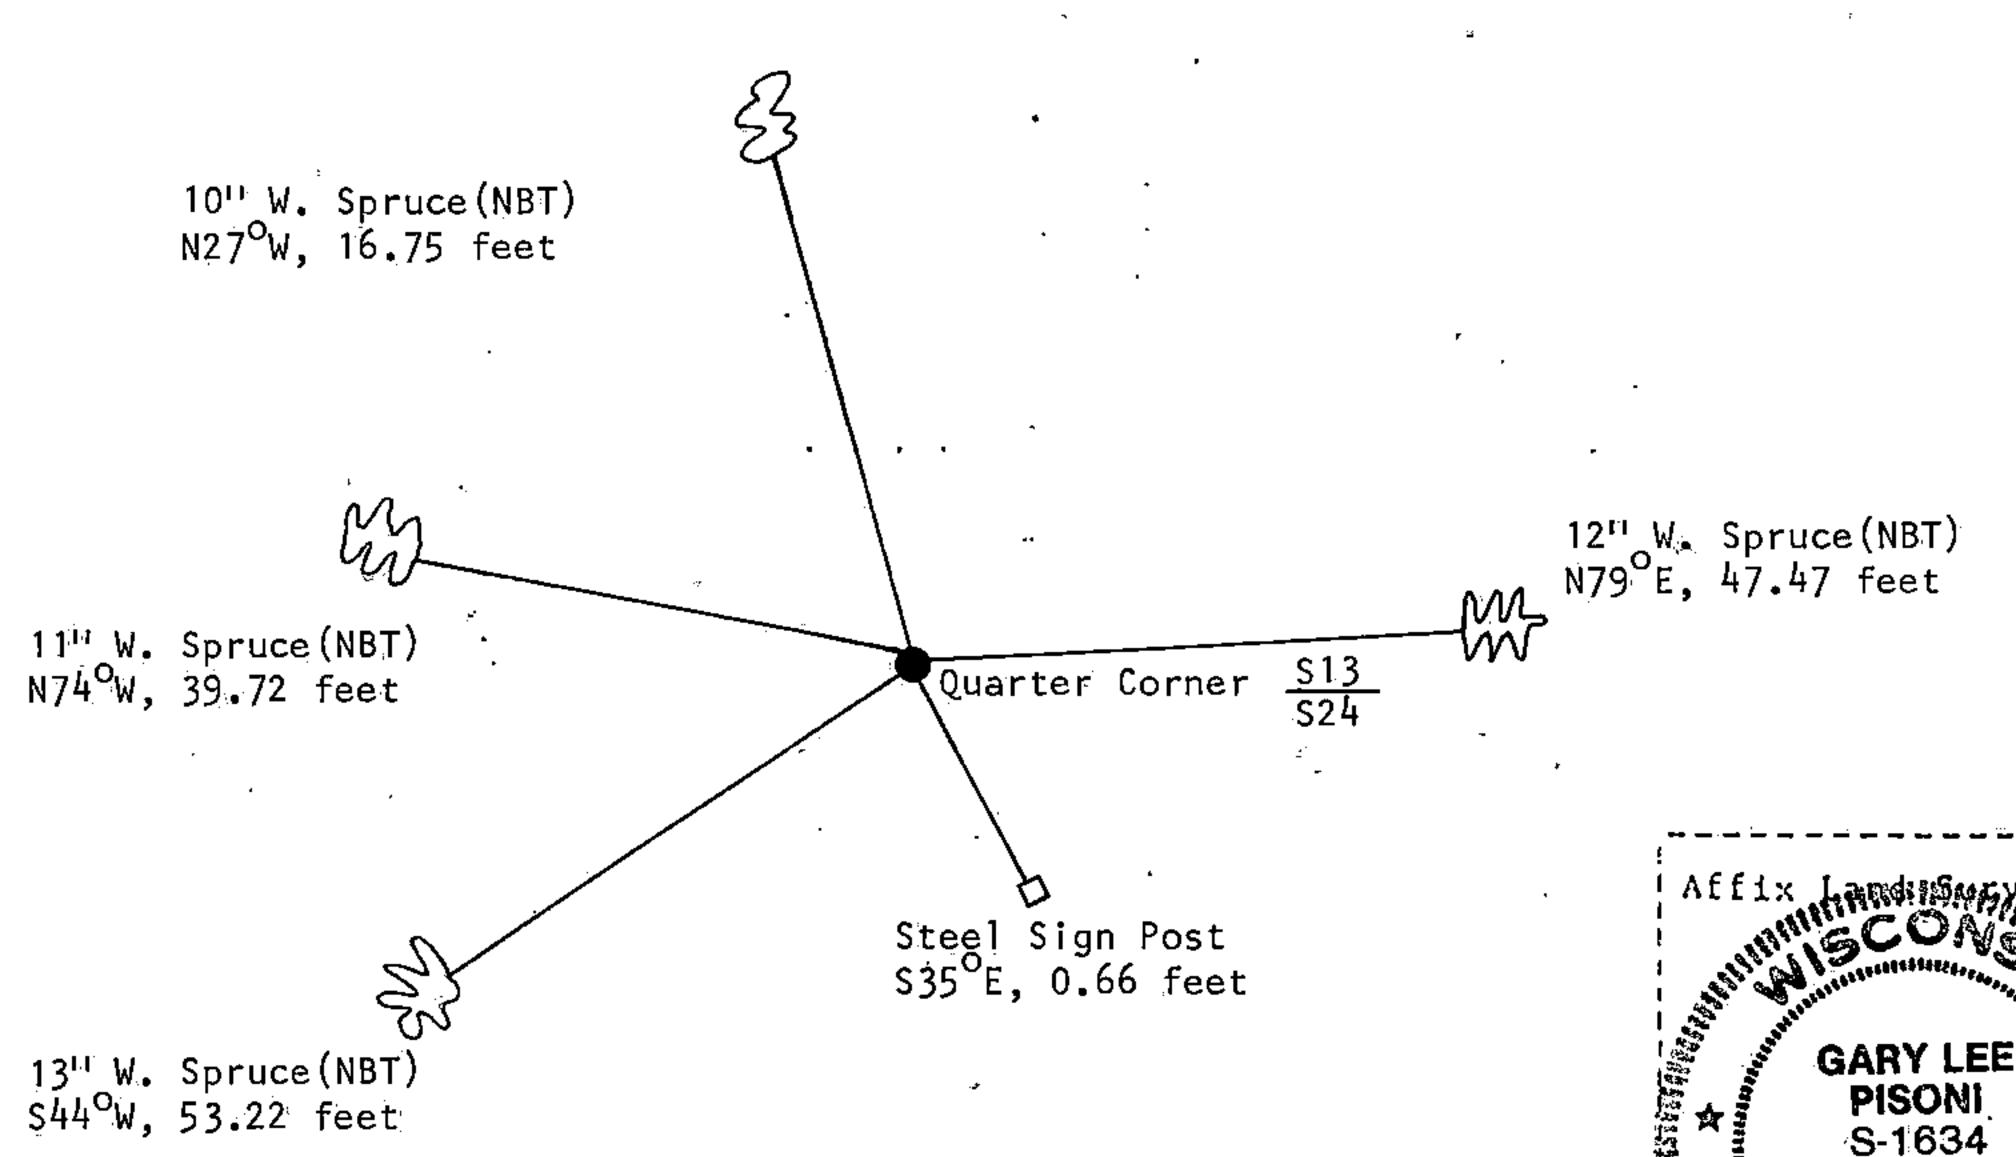

(i) I, Gary L. Pisoni (type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature Signature 11/21/91

District Ranger

Date

IRON RIVER,

ΜI