44013210020

Stock No. 2627

26273	NUMBER	
Š	I.I.	
Stock	OCUME	Post

		1 4 610	CHIDNEY	MONUMENT	DECODD
U.J.	LODLIC	LAND	SOLACI	IMPLAIMENT	ハムししれか

Index	Nο	R-11
111000	• • • • • • • • • • • • • • • • • • •	

State County of	of Wisc	onsin) ₅₅			
County of	Forest	<u></u>	} 33.			
I William B. Cochrane do hereby certify that on the 30th day of May 19.91 I found evidence of the South Quarter corner of Section 21 Township 40 North, Range 13 East Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner.						
Resident wi	tnesses:					
••••		:s				
······································	·····					
····•	· • · · · · · · · · · · · · · · · ·		• • • • • • • • • • • • • • • • • • • •			
		i i	-			
	<u> </u>	· i [
<u> </u>		1				
	_SECT10	<u>N</u> 21				
		. , [] T !				
	<i>:</i>	, . !				
		ı — — ī				
,		i i				
		restored.				

•

History of original corner establishment:

Original Government Survey in 1865 by William E. Daugherty. West corrected between Sections 21 and 28, at 40.00 chains, set Quarter Section Post, from which the following bear;

 Sugar
 14"
 N55°E
 4 1ks.

 Sugar
 14"
 S11°E
 15 1ks.

Description of corner evidence found:

No corner evidence was recovered.

I re-established the corner position at mid-point and on line between the Southeast and Southwest Section Corners of Section 21.

Description of monument and accessories I established to perpetuate the original location of this corner. At the corner position, set a $2\frac{1}{2}$ inch diameter aluminum pipe monument, 3 feet long, $2\frac{1}{2}$ feet in the ground, with an aluminum cap stamped; T40N R13E, 1/4, S21 S28, 1991, S-1107. From which the following new blazed and scribed bearing trees bear;

 R. Pine
 10"
 N42°E
 16.22 feet

 R. Pine
 10"
 N56°W
 11.61 feet

 Set- Steel Sign Post
 Northwest
 0.50 feet

Dated at Hiles , Wis., this 19th day of February , 1992

Signature William B. Cochrane Title Land Surveyor Registration No. S-1107

(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Office of Register of Deeds, County of Follat instrument was filed in this office for record on the 3/21 day of Cugust 1922

(Register of Deeds)

Deputy


Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.


See drawing below.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(gkh) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

Re-established through lost corner proportionate methods.

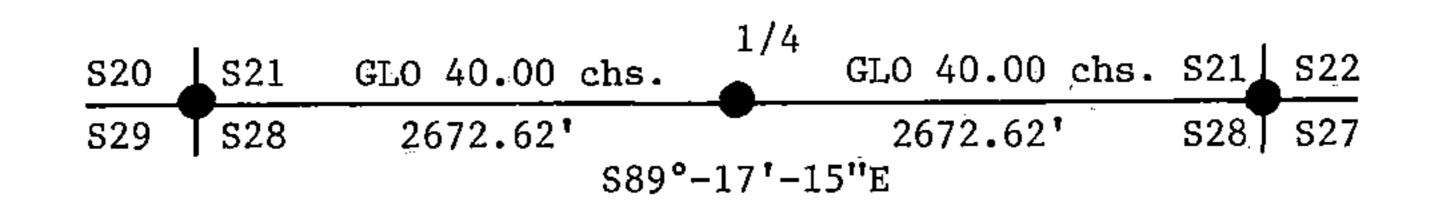

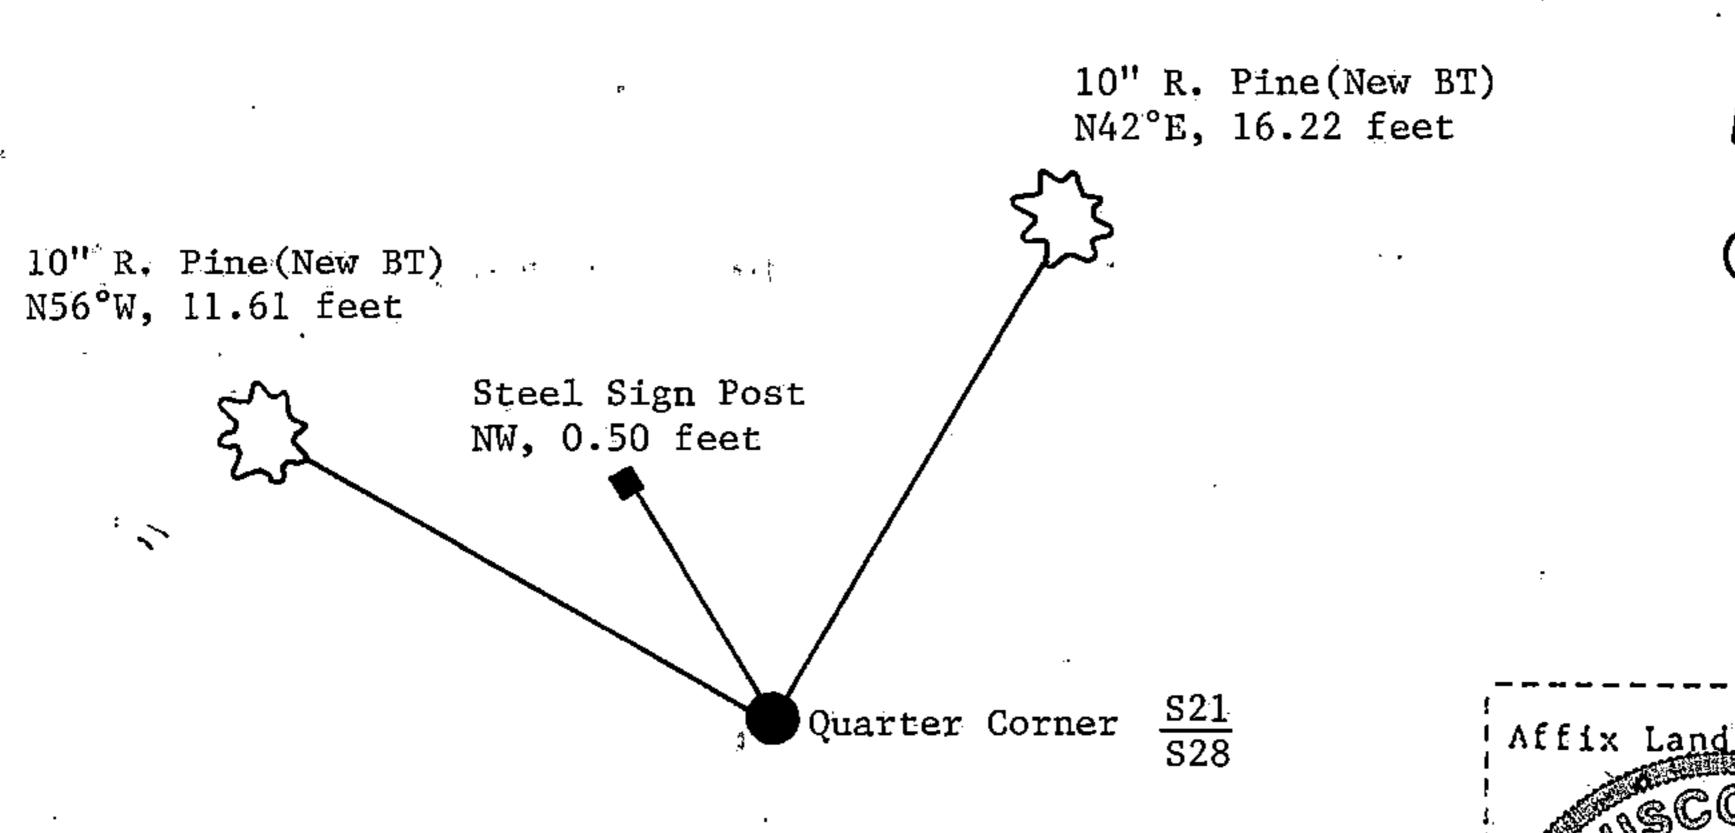

Affix Land Surveyor Scal

WILLIAM B.

COCHRANE

S-1107

HILES,

WISCONSIN

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

William B. Cochrane March 25, 1992

Survey requested by;

(4)

District Ranger

3/23/97

Date