



Stock No. 26273

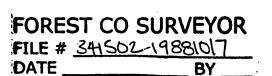


Sheet 1 of 3

PLAT OF SURVEY FOR CERTIFIED LAND CORNER RESTORATION

SECTION 2, T34N, R15E, FOURTH PRINCIPAL MERIDIAN FOREST COUNTY, STATE OF WISCONSIN

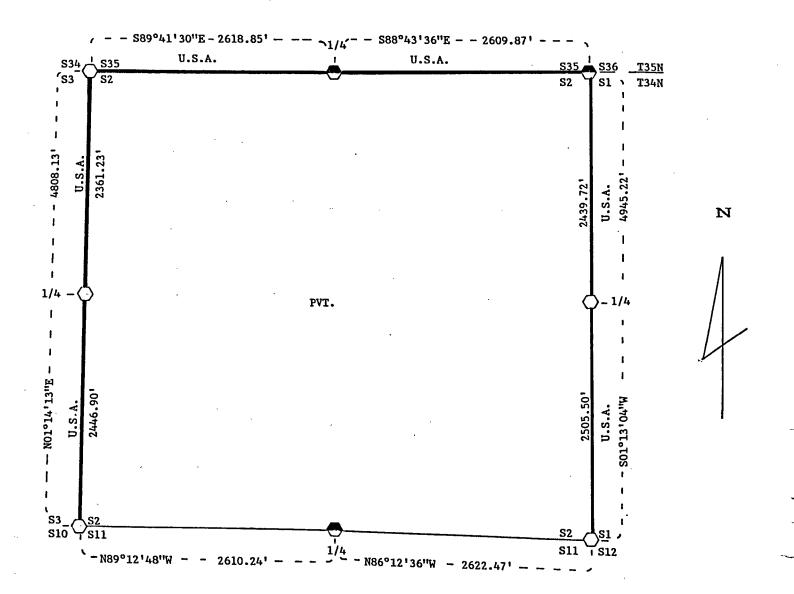

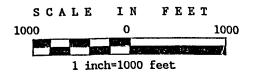

LEGEND

Boundary line marked to standard.

- 2 1/2" diameter aluminum pipe monument, 30 or 36 inches long with an aluminum cap stamped to identify the corner.
- 2" diameter galvanized iron pipe monument, 60 inches long filled with concrete with a brass cap stamped to identify the corner.

NOTE: Bearings are referenced to polaris observations.

SURVEY NOTES

This survey was made by John C. Schulke, a Registered Land Surveyor in the State of Wisconsin, for the U.S. Department of Agriculture, Forest Service. The purpose of the survey was for recovery, establishing, marking and perpetuating the corners and boundary lines of the U.S. Government Land on the perimeter of Section 2, Township 34 North, Range 15 East, Fourth Principal Meridian, Forest County, Wisconsin.

The Original Government Survey of the township boundary was done by Artemas Curtis in 1857. The Original Government Subdivision survey of this township was done by James McBride in 1859.

The bearings between corner positions are true bearings as determined by reference to polaris observations. The accuracy of this survey exceeds the State requirement for closure of 1 in 3,000. Corners recovered or established by this survey are marked as described in the map legend. Each monumented corner is referenced to blazed, scribed, painted and tagged bearing trees. Tie bearings are magnetic, and not corrected for declination.

CORNERS RECOVERED AND RESTORED

- 1. Section Corner Common to Sections 2, 3, 34 and 35.

 Corner monument recovered in place and as described on a U.S. Public Land Survey Monument Record form filed in the Forest County Register of Deed's Office, Document #127215, in Oct. 1984 by Alan Harrison (RLS-1651).
- 2. Quarter Corner Between Sections 2 and 35. Corner monument recovered in place.

Recovered corner referen	ces:	•	,	
Sugar Maple	19"	NO1°W	17.56	feet
Sugar Maple	18"	S88°E	20.24	feet
Balsam (dying)	14"	S48°E	4.29	feet
Aspen (dying)	19"	N41°W	14.15	feet
decayed wood post		North	1.5	feet
New corner references:		•		
Red Maple	10"	N46°E	38.47	feet
Sugar Maple	9"	S64°W	25.39	feet
Steel sign post	•	West	1.3	feet

- 3. Section Corner Common to Sections 1, 2, 35 and 36.

 Corner monument recovered in place and as described on a Certified Land Corner Restoration form filed in the Forest County Register of Deed's Office, Document #98035, in May 1970 by Jean Resvick (RLS-802).
- 4. <u>Quarter Corner Between Sections 1 and 2.</u> Restored by proportionate measurement. Monument placed in a mound of stones.

Corner references:			
Basswood	11"	N74°W	17.40 feet
Sugar Maple	5"	S64°E	31.91 feet
Sugar Maple	8"	S21°E	31.97 feet
Sugar Maple	7"	S27°W	34.92 feet
Steel sign post		East	1.1 feet

- 5. Section Corner Common to Sections 1, 2, 11 and 12. Corner monument recovered in place and as described on a U.S. Public Land Survey Monument Record form filed in the Forest County Register of Deed's Office, Document #127085, in Dec. 1984 by Milo Stefan (RLS-1558).
- 6. Quarter Corner Between Sections 2 and 11.
 Corner monument recovered in place and as described on a Certified Land Corner Restoration form filed in the Forest County Register of Deed's Office, Document #98036, in May 1970 by Jean Resvick (RLS-802).
- 7. Section Corner Common to Sections 2, 3, 10 and 11. Corner monument recovered in place and as described on a U.S. Public Land Survey Monument Record form filed in the Forest County Register of Deed's Office, Document #127084, in Dec. 1984 by Milo Stefan (RLS-1558).
- 8. Quarter Corner Between Sections 2 and 3. Restored by proportionate measurement.


Co	rner references:		•	·
	Sugar Maple	1411	N44°W	56.25 feet
	Sugar Maple	811	North	20.94 feet
	Yellow Birch	411	S74°E	44.25 feet
	Sugar Maple	6"	S38°W	41.03 feet
	Steel sign post		South	1.0 feet

SURVEYOR'S AFFIDAVIT

State of Wisconsin)

I, John C. Schulke, a Cadastral Surveyor, and a Registered Land Surveyor in the State of Wisconsin, hereby certify that I have surveyed Section 2, Township 34 North, Range 15 East, Fourth Principal Meridian, State of Wisconsin.

The plat map and survey notes herewith are a correct representation of the land surveyed. I have surveyed said section in accordance with the rules for the survey of the public lands and with the statutes of the State of Wisconsin.

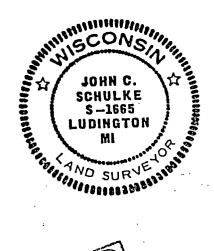

John C. Schulke 4604 So. Pere Marquette Rd. 49431 Ludington, MI R.L.S. State of Wisconsin Date of Survey 1988 Certificate S-1665

17+4_

Plat ready for filing