

Stock No. 26273

Sheet 2 of 5

SURVEY NOTES

This survey was made by John C. Schulke, a Registered Land Surveyor in the State of Wisconsin, for the U.S. Department of Agriculture, Forest Service. The purpose of the survey was for recovery, establishing, marking and perpetuating the corners and boundary lines of the U.S. Government Land on the perimeter and within Section 27, Township 41 North, Range 13 East, Fourth Principal Meridian, Forest County, Wisconsin.

The original Government subdivision survey of this township was made by Daugherty and McDill in 1865. A dependent resurvey done under the supervision of Mr. Veal was made and approved by the General Land Office in 1942. The control for this survey is based on the 1942 dependent resurvey.

The bearings between corner positions are true bearings as determined by reference to polaris observations. The accuracy of this survey exceeds the State requirement for closure of 1 in 3,000. Corners recovered or established by this survey are marked as described in the map legend. Each monumented corner is referenced to blazed, scribed, painted and tagged bearing trees. Tie bearings are magnetic, and not corrected for declination.

CORNERS RECOVERED AND RESTORED1. Quarter Corner Between Sections 27 and 28.

Corner monument recovered in place.

Corner references recovered:

Cedar	22"	N19°E	30.63 feet
Cedar	18"	N55°W	47.76 feet
W. Pine stump	18"	S56°E	11.88 feet

New corner references:

Poplar	19"	S70°W	34.50 feet
Cedar	19"	S33°E	8.64 feet
Steel sign post		NW	within 2.0 feet

2. Section Corner Common to Sections 27, 28, 33 and 34.

Corner monument recovered in place. Certified Land Corner Restoration form has been filed in the Forest County records, Document #109814, in 1976.

Corner references recovered:

Spruce stump	13"	N24°E	8.08 feet
Spruce	8"	S36°E	16.46 feet

New corner references:

Spruce	9"	S35°W	23.62 feet
"X" chiseled on Boulder	5'ht. 8'W	N36°W	53.70 feet
"X" chiseled on Boulder	5'ht. 12'W	N17°E	42.75 feet
Steel sign post		NW	2.2 feet

3. Quarter Corner Between Sections 27 and 34.

Corner monument recovered in place.

Corner references recovered:

Cedar	15"	N65°E	47.01 feet
W. Birch	6"	N52°E	33.19 feet
Cedar stub	7"	S25°W	20.02 feet
Spruce	6"	S61°W	31.13 feet
Steel sign post		NW	0.5 feet

Stock No. 26273

Sheet 3 of 5

- New corner references:
 Double Cedar 18" N23°W 53.16 feet
4. Section Corner Common to Sections 26, 27, 34 and 35.
 Recovered 1942 Dependent Resurvey monument laying down. Reset firmly in the ground.
- Corner references recovered:
 Cedar stump 8" N80°W 25.08 feet
- New corner references:
 Cedar 15" S46°W 154.2 feet
 Poplar 4" N07°W 26.61 feet
 Spruce 3" N72°W 31.18 feet
 Spruce 5" N58°E 75.19 feet
 Steel sign post N06°E 1.5 feet
5. Quarter Corner Between Sections 26 and 27.
 Corner monument recovered in place.
- Corner references recovered:
 W. Pine stump 20" N08°W 21.78 feet
 W. Pine stump 16" N57°E 11.22 feet
- New corner references:
 Red Pine 12" N87°W 17.84 feet
 Red Pine 10" S29°W 16.31 feet
 Red Pine 7" S69°E 8.21 feet
 Red Pine 9" N50°E 22.46 feet
 Steel sign post NW 1.75 feet
6. Section Corner Common to Sections 22, 23, 26 and 27.
 Corner monument recovered in place.
- Corner references recovered:
 Cedar stump 14" S20°W 28.05 feet
 Cedar snag 12" N20°W 37.95 feet
- New corner references:
 Balsam 8" N84°W 36.86 feet
 Poplar 9" S56°W 33.6 feet
 Balsam 14" S10°E 53.75 feet
 Poplar 10" N33°W 30.64 feet
 Steel sign post West 1.9 feet
7. Quarter Corner Between Sections 22 and 27.
 Corner monument recovered in place.
- Corner references recovered:
 Cedar 18" North 34.03 feet
 Cedar 12" S32°E 18.60 feet
- New corner references:
 Sug. Maple 6" S64°W 27.88 feet
 Cedar 8" S88°E 17.22 feet
 Steel sign post NE 1.0 foot

Stock No. 26273

Sheet 4 of 5

8. Section Corner Common to Sections 21, 22, 27 and 28.
 Corner monument recovered in place and as described on Certified Land Corner Restoration form in the Forest County Records, Document #98070, in 1970.

CORNERS ESTABLISHED

1. Center Quarter Corner of Section 27.
 Corner position established at the intersection of the straight lines between opposing quarter corners on the perimeter of Section 27.
- Corner references:
- | | | | |
|-----------------|-----|-------|------------|
| Cedar | 10" | N72°E | 23.52 feet |
| Cedar | 8" | S38°E | 15.78 feet |
| W. Pine | 18" | N81°W | 96.36 feet |
| Steel sign post | | N05°W | 1.3 feet |
2. Center West Sixteenth Corner of Section 27.
 Corner position established at the midpoint and on line between the West quarter corner and the Center quarter corner of Section 27.
- Corner references:
- | | | | |
|-----------------|-----|-------|------------|
| Cedar | 18" | S63°E | 9.35 feet |
| Sug. Maple | 4" | N48°W | 9.17 feet |
| Red Maple | 15" | S44°W | 48.95 feet |
| Steel sign post | | NE | 1.0 foot |
3. Southwest Sixteenth Corner of Section 27.
 Corner position is at the intersection of the straight lines between opposing sixteenth corners on the perimeter of the Southwest quarter of Section 27.
- Corner references:
- | | | | |
|-----------------|-----|-------|------------|
| Red Pine | 15" | N55°E | 27.11 feet |
| Red Pine | 16" | S59°E | 24.37 feet |
| Red Pine | 14" | S80°W | 54.14 feet |
| Steel sign post | | SW | 1.5 feet |
4. Center South Sixteenth Corner of Section 27.
 Corner position established at the midpoint and on line between the South quarter corner and the Center quarter corner of Section 27.
- Corner references:
- | | | | |
|-----------------|-----|-------|------------|
| W. Birch | 5" | S86°E | 43.84 feet |
| Spruce | 11" | S40°W | 34.5 feet |
| Spruce | 5" | N24°W | 12.05 feet |
| Steel sign post | | SE | 1.0 foot |
5. Southeast Sixteenth Corner of Section 27.
 Corner position is at the intersection of the straight lines between opposing sixteenth corners on the perimeter of the Southeast quarter of Section 27.
- Corner references:
- | | | | |
|-----------------|-----|-------|------------|
| W. Birch | 5" | S25°E | 27.22 feet |
| W. Birch | 4" | S84°W | 12.71 feet |
| Balsam | 10" | N15°E | 22.43 feet |
| Steel sign post | | SE | 1.2 feet |

Stock No. 26273

Sheet 5 of 5

6. Center East Sixteenth Corner of Section 27.
Corner position established at the midpoint and on line between the East quarter corner and the Center quarter corner of Section 27.

Corner references:

Cedar	10"	S54°E	6.03 feet
W. Birch	6"	S38°W	28.55 feet
W. Birch	8"	N28°E	2.14 feet
Steel sign post		SE	1.3 feet

7. East Sixteenth Corner Between Sections 22 and 27.
Corner position established at the midpoint and on line between the North quarter corner and the Northeast Section corner of Section 27.

Corner references:


Red Maple	7"	N15°E	12.41 feet
Cedar	15"	S88°E	23.07 feet
Cedar	17"	S79°W	38.60 feet
Steel sign post		SE	1.3 feet

SURVEYOR'S AFFIDAVIT

State of Wisconsin))
County of Forest) ss

I, John C. Schulke, a Cadastral Surveyor, and a Registered Land Surveyor in the State of Wisconsin, hereby certify that I have surveyed and subdivided Section 27, Township 41 North, Range 13 East, Fourth Principal Meridian, State of Wisconsin.

The plat map and survey notes herewith are a correct representation of the land surveyed and subdivided. I have surveyed and subdivided said section in accordance with the rules for the survey of the public lands and with the statutes of the State of Wisconsin.

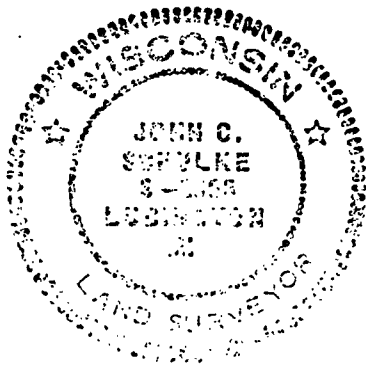


John C. Schulke
4604 South U.S.-31
Ludington, MI 49431
R.L.S. State of Wisconsin
Date of Survey 1985
Certificate S-1665

John C. Schulke

Plat ready for filing: *D. Frank Healey*

District Ranger

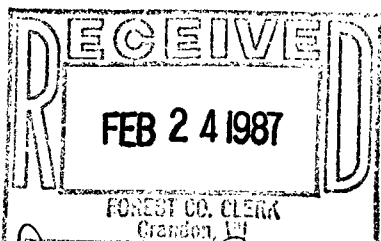

Dora C. James
Forest Co. Clerk